

## SECTION 1: Identification

### 1.1. Identification

Product form : Mixture  
Trade name : SILVALOY® 501  
Product code : A00000002

### 1.2. Recommended use and restrictions on use

Recommended use : Alloys for brazing/soldering and other metallurgical processes

### 1.3. Supplier

Lucas-Milhaupt, Inc.  
5656 South Pennsylvania Ave.  
Cudahy, WI 53110 - USA  
T (414)-769-6000  
[LM\\_SDSinfo@lucasmilhaupt.com](mailto:LM_SDSinfo@lucasmilhaupt.com) - [www.Lucasmilhaupt.com](http://www.Lucasmilhaupt.com)

### 1.4. Emergency telephone number

Emergency number : CHEMTREC within the USA and Canada: 1-800-424-9300  
CHEMTREC outside the USA and Canada +1 701-741-5970

## SECTION 2: Hazard(s) identification

### 2.1. Classification of the substance or mixture

#### GHS-US classification

Specific target organ toxicity — Single exposure, Category 3, Narcosis H336 May cause drowsiness or dizziness.

Full text of H statements : see section 16

### 2.2. GHS Label elements, including precautionary statements

#### GHS-US labelling

Hazard pictograms (GHS-US) :



Signal word (GHS-US) : Warning  
Hazard statements (GHS-US) : H336 - May cause drowsiness or dizziness.  
Precautionary statements (GHS-US) : P261 - Avoid breathing dust/fume/gas/mist/vapours/spray.  
P271 - Use only outdoors or in a well-ventilated area.  
P304+P340 - If inhaled: Remove person to fresh air and keep comfortable for breathing  
P312 - Call a poison center/doctor if you feel unwell  
P403+P233 - Store in a well-ventilated place. Keep container tightly closed.  
P405 - Store locked up.  
P501 - Dispose of contents/container to hazardous or special waste collection point, in accordance with local, regional, national and/or international regulation

### 2.3. Other hazards which do not result in classification

No additional information available

### 2.4. Unknown acute toxicity (GHS US)

Not applicable

## SECTION 3: Composition/information on ingredients

### 3.1. Substances

Not applicable

### 3.2. Mixtures

Name	Product identifier	%
Silver	(CAS-No.) 7440-22-4	49 - 51
Copper	(CAS-No.) 7440-50-8	33 - 35

# SILVALOY® 501

## Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Name	Product identifier	%
Zinc	(CAS-No.) 7440-66-6	14 - 18

Full text of hazard classes and H-statements : see section 16

### SECTION 4: First-aid measures

#### 4.1. Description of first aid measures

- First-aid measures general : Call a poison center or a doctor if you feel unwell.
- First-aid measures after inhalation : Remove person to fresh air and keep comfortable for breathing. Call a poison center or a doctor if you feel unwell.
- First-aid measures after skin contact : Wash skin with plenty of water.
- First-aid measures after eye contact : Rinse eyes with water as a precaution.
- First-aid measures after ingestion : Call a poison center or a doctor if you feel unwell. Rinse mouth.

#### 4.2. Most important symptoms and effects (acute and delayed)

- Symptoms/effects : May cause drowsiness or dizziness.
- Symptoms/effects after inhalation : May cause respiratory irritation.

#### 4.3. Immediate medical attention and special treatment, if necessary

Treat symptomatically.

### SECTION 5: Fire-fighting measures

#### 5.1. Suitable (and unsuitable) extinguishing media

- Suitable extinguishing media : Dry powder. Water spray. Foam.
- Unsuitable extinguishing media : Water.

#### 5.2. Specific hazards arising from the chemical

- Reactivity : The product is non-reactive under normal conditions of use, storage and transport.

#### 5.3. Special protective equipment and precautions for fire-fighters

- Protection during firefighting : Do not attempt to take action without suitable protective equipment. Self-contained breathing apparatus. Complete protective clothing.

### SECTION 6: Accidental release measures

#### 6.1. Personal precautions, protective equipment and emergency procedures

##### 6.1.1. For non-emergency personnel

- Emergency procedures : Ventilate spillage area. Avoid breathing dust/fume/gas/mist/vapours/spray.

##### 6.1.2. For emergency responders

- Protective equipment : Do not attempt to take action without suitable protective equipment. For further information refer to section 8: "Exposure controls/personal protection".

#### 6.2. Environmental precautions

Avoid release to the environment.

#### 6.3. Methods and material for containment and cleaning up

- For containment : Collect spillage.
- Methods for cleaning up : Mechanically recover the product.
- Other information : Dispose of materials or solid residues at an authorized site.

#### 6.4. Reference to other sections

For further information refer to section 13.

### SECTION 7: Handling and storage

#### 7.1. Precautions for safe handling

- Precautions for safe handling : Wear personal protective equipment. Use only outdoors or in a well-ventilated area. Avoid breathing dust/fume/gas/mist/vapours/spray.
- Hygiene measures : Do not eat, drink or smoke when using this product. Always wash hands after handling the product.

#### 7.2. Conditions for safe storage, including any incompatibilities

- Storage conditions : Store in a well-ventilated place. Keep cool. Store locked up. Keep container tightly closed.

# SILVALOY® 501

## Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

### SECTION 8: Exposure controls/personal protection

#### 8.1. Control parameters

<b>Silver (7440-22-4)</b>		
ACGIH	ACGIH TWA (mg/m <sup>3</sup> )	0.1 mg/m <sup>3</sup> (dust and fume)
OSHA	OSHA PEL (TWA) (mg/m <sup>3</sup> )	0.01 mg/m <sup>3</sup>
IDLH	US IDLH (mg/m <sup>3</sup> )	10 mg/m <sup>3</sup> (dust)
NIOSH	NIOSH REL (TWA) (mg/m <sup>3</sup> )	0.01 mg/m <sup>3</sup> (dust)
<b>Copper (7440-50-8)</b>		
ACGIH	ACGIH TWA (mg/m <sup>3</sup> )	0.2 mg/m <sup>3</sup> (fume)
OSHA	OSHA PEL (TWA) (mg/m <sup>3</sup> )	0.1 mg/m <sup>3</sup> (fume) 1 mg/m <sup>3</sup> (dust and mist)
IDLH	US IDLH (mg/m <sup>3</sup> )	100 mg/m <sup>3</sup> (dust, fume and mist)
NIOSH	NIOSH REL (TWA) (mg/m <sup>3</sup> )	1 mg/m <sup>3</sup> (dust and mist) 0.1 mg/m <sup>3</sup> (fume)
<b>Zinc (7440-66-6)</b>		
ACGIH	ACGIH TWA (mg/m <sup>3</sup> )	2 mg/m <sup>3</sup> (as ZnO)

#### 8.2. Appropriate engineering controls

Appropriate engineering controls : Ensure good ventilation of the work station.  
Environmental exposure controls : Avoid release to the environment.

#### 8.3. Individual protection measures/Personal protective equipment

##### Hand protection:

Protective gloves

##### Eye protection:

Safety glasses

##### Skin and body protection:

Wear suitable protective clothing

##### Respiratory protection:

In case of insufficient ventilation, wear suitable respiratory equipment

### SECTION 9: Physical and chemical properties

#### 9.1. Information on basic physical and chemical properties

Physical state : Solid  
Appearance : White to light yellow metallic luster, various forms.  
Colour : No data available  
Odour : No data available  
Odour threshold : No data available  
pH : No data available  
Melting point : 1425 °F  
Freezing point : Not applicable  
Boiling point : No data available  
Flash point : Not applicable  
Relative evaporation rate (butylacetate=1) : No data available  
Flammability (solid, gas) : Non flammable.  
Vapour pressure : No data available  
Relative vapour density at 20 °C : No data available

# SILVALOY® 501

## Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Relative density	: Not applicable
Solubility	: No data available
Log Pow	: No data available
Auto-ignition temperature	: Not applicable
Decomposition temperature	: No data available
Viscosity, kinematic	: Not applicable
Viscosity, dynamic	: No data available
Explosive limits	: Not applicable
Explosive properties	: No data available
Oxidising properties	: No data available

### 9.2. Other information

No additional information available

## SECTION 10: Stability and reactivity

### 10.1. Reactivity

The product is non-reactive under normal conditions of use, storage and transport.

### 10.2. Chemical stability

Stable under normal conditions.

### 10.3. Possibility of hazardous reactions

No dangerous reactions known under normal conditions of use.

### 10.4. Conditions to avoid

None under recommended storage and handling conditions (see section 7).

### 10.5. Incompatible materials

Oxidizing agent. Strong acids. Strong bases.

### 10.6. Hazardous decomposition products

Under normal conditions of storage and use, hazardous decomposition products should not be produced.

## SECTION 11: Toxicological information

### 11.1. Information on toxicological effects

Acute toxicity : Not classified

<b>Silver (7440-22-4)</b>	
LD50 oral rat	> 5000 mg/kg
LD50 dermal rat	> 2000 mg/kg

<b>Zinc (7440-66-6)</b>	
LD50 oral rat	630 mg/kg

Skin corrosion/irritation	: Not classified
Serious eye damage/irritation	: Not classified
Respiratory or skin sensitisation	: Not classified
Germ cell mutagenicity	: Not classified
Carcinogenicity	: Not classified

Reproductive toxicity	: Not classified
Specific target organ toxicity (single exposure)	: May cause drowsiness or dizziness.

Specific target organ toxicity (repeated exposure)	: Not classified
--	------------------

Aspiration hazard	: Not classified
-------------------	------------------

Symptoms/effects	: May cause drowsiness or dizziness.
Symptoms/effects after inhalation	: May cause respiratory irritation.

# SILVALOY® 501

## Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

### SECTION 12: Ecological information

#### 12.1. Toxicity

Ecology - general : Very toxic to aquatic life.

<b>Silver (7440-22-4)</b>	
LC50 fish 1	0.00155 - 0.00293 mg/l (Exposure time: 96 h - Species: Pimephales promelas [static])
EC50 Daphnia 1	0.00024 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])
LC50 fish 2	0.0062 mg/l (Exposure time: 96 h - Species: Oncorhynchus mykiss [flow-through])
<b>Copper (7440-50-8)</b>	
LC50 fish 1	0.0068 - 0.0156 mg/l (Exposure time: 96 h - Species: Pimephales promelas)
EC50 Daphnia 1	0.03 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])
LC50 fish 2	< 0.3 mg/l (Exposure time: 96 h - Species: Pimephales promelas [static])
<b>Zinc (7440-66-6)</b>	
LC50 fish 1	2.16 - 3.05 mg/l (Exposure time: 96 h - Species: Pimephales promelas [flow-through])
EC50 Daphnia 1	0.139 - 0.908 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])
LC50 fish 2	0.211 - 0.269 mg/l (Exposure time: 96 h - Species: Pimephales promelas [semi-static])

#### 12.2. Persistence and degradability

No additional information available

#### 12.3. Bioaccumulative potential

No additional information available

#### 12.4. Mobility in soil

No additional information available

#### 12.5. Other adverse effects

No additional information available

### SECTION 13: Disposal considerations

#### 13.1. Disposal methods

Waste treatment methods : Dispose of contents/container in accordance with licensed collector's sorting instructions.

### SECTION 14: Transport information

#### Department of Transportation (DOT)

In accordance with DOT

Not applicable

#### Transportation of Dangerous Goods

Not applicable

#### Transport by sea

Not applicable

#### Air transport

Not applicable

### SECTION 15: Regulatory information

#### 15.1. US Federal regulations

# SILVALOY® 501

## Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

<b>Silver (7440-22-4)</b>	
Listed on the United States TSCA (Toxic Substances Control Act) inventory Subject to reporting requirements of United States SARA Section 313	
CERCLA RQ	1000 lb no reporting of releases of this hazardous substance is required if the diameter of the pieces of the solid metal released is >100 µm
<b>Copper (7440-50-8)</b>	
Listed on the United States TSCA (Toxic Substances Control Act) inventory Subject to reporting requirements of United States SARA Section 313	
CERCLA RQ	5000 lb no reporting of releases of this hazardous substance is required if the diameter of the pieces of the solid metal released is >100 µm
<b>Zinc (7440-66-6)</b>	
Listed on the United States TSCA (Toxic Substances Control Act) inventory Subject to reporting requirements of United States SARA Section 313	
CERCLA RQ	454 kg no reporting of releases of this hazardous substance is required if the diameter of the pieces of the solid metal released is >100 µm

### 15.2. International regulations

<b>Silver (7440-22-4)</b>
Listed on the TCSI (Taiwan Chemical Substance Inventory)
<b>Copper (7440-50-8)</b>
Listed on the TCSI (Taiwan Chemical Substance Inventory)
<b>Zinc (7440-66-6)</b>
Listed on the TCSI (Taiwan Chemical Substance Inventory)

### 15.3. US State regulations


<b>Silver (7440-22-4)</b>
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) List
<b>Copper (7440-50-8)</b>
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) List
<b>Zinc (7440-66-6)</b>
U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) List

## SECTION 16: Other information

Full text of H-statements:

H336	May cause drowsiness or dizziness.
------	------------------------------------

NFPA health hazard	: 2 - Materials that, under emergency conditions, can cause temporary incapacitation or residual injury.
NFPA fire hazard	: 1 - Materials that must be preheated before ignition can occur.
NFPA reactivity	: 1 - Materials that in themselves are normally stable but can become unstable at elevated temperatures and pressures.

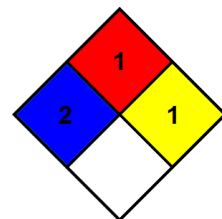

# SILVALOY® 501

## Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

---

### Hazard Rating

- Health : 2 Moderate Hazard - Temporary or minor injury may occur  
\* - Chronic (long-term) health effects may result from repeated overexposure
- Flammability : 1 Slight Hazard - Materials that must be preheated before ignition will occur. Includes liquids, solids and semi solids having a flash point above 200 F. (Class IIIB)
- Physical : 1 Slight Hazard - Materials that are normally stable but can become unstable (self-react) at high temperatures and pressures. Materials may react non-violently with water or undergo hazardous polymerization in the absence of inhibitors.
- Personal protection : B  
B - Safety glasses, Gloves

SDS US (GHS HazCom 2012)

*Although reasonable care has been taken in the preparation of this document, we extend no warranties and make no representations as to the accuracy or completeness of the information contained therein, and assume no responsibility regarding the suitability of this information for the user's intended purposes or for the consequences of its use. Each individual should make a determination as to the suitability of the information for their particular purpose(s).*  
Lucas-Milhaupt, Inc.