

SECTION 1: Identification

1.1. Identification

Product form : Mixture
 Trade name : BRAZE 711 VTG
 Product code : A00000308

1.2. Recommended use and restrictions on use

No additional information available

1.3. Supplier

Lucas-Milhaupt, Inc.
 5656 South Pennsylvania Ave.
 Cudahy, WI 53110 - USA
 T (414)-769-6000
LM_SDSinfo@lucasmilhaupt.com - www.Lucasmilhaupt.com

1.4. Emergency telephone number

Emergency number : CHEMTREC within the USA and Canada: 1-800-424-9300
 CHEMTREC outside the USA and Canada +1 701-741-5970

SECTION 2: Hazard(s) identification

2.1. Classification of the substance or mixture

GHS US classification

Skin sensitisation, Category 1 H317 : May cause an allergic skin reaction.
 Carcinogenicity, Category 1B H350 : May cause cancer.

Full text of H statements : see section 16

2.2. GHS Label elements, including precautionary statements

GHS US labelling

Hazard pictograms (GHS US) :



Signal word (GHS US) : Warning

Hazard statements (GHS US) : H317 - May cause an allergic skin reaction.
 H350 - May cause cancer.

Precautionary statements (GHS US) : P201 - Obtain special instructions before use.
 P202 - Do not handle until all safety precautions have been read and understood.
 P261 - Avoid breathing dust/fume/gas/mist/vapours/spray.
 P272 - Contaminated work clothing must not be allowed out of the workplace
 P280 - Wear protective gloves/protective clothing/eye protection/face protection.
 P302+P352 - If on skin: Wash with plenty of water
 P308+P313 - If exposed or concerned: Get medical advice/attention.
 P321 - Specific treatment (see supplemental first aid instruction on this label)
 P333+P313 - If skin irritation or rash occurs: Get medical advice/attention.
 P363 - Wash contaminated clothing before reuse.
 P405 - Store locked up.
 P501 - Dispose of contents/container to hazardous or special waste collection point, in accordance with local, regional, national and/or international regulation

2.3. Other hazards which do not result in classification

No additional information available

2.4. Unknown acute toxicity (GHS US)

Not applicable

BRAZE 711 VTG

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 3: Composition/information on ingredients

3.1. Substances

Not applicable

3.2. Mixtures

Name	Product identifier	%
Silver	(CAS-No.) 7440-22-4	70.15 - 72.15
Copper	(CAS-No.) 7440-50-8	26.9 - 29.3
Nickel	(CAS-No.) 7440-02-0	0.55 - 0.95

Full text of hazard classes and H-statements : see section 16

SECTION 4: First-aid measures

4.1. Description of first aid measures

- First-aid measures general : IF exposed or concerned: Get medical advice/attention.
- First-aid measures after inhalation : Remove person to fresh air and keep comfortable for breathing.
- First-aid measures after skin contact : Take off contaminated clothing. If skin irritation or rash occurs: Get medical advice/attention. Wash skin with plenty of water.
- First-aid measures after eye contact : Rinse eyes with water as a precaution.
- First-aid measures after ingestion : Call a poison center or a doctor if you feel unwell. Rinse mouth.

4.2. Most important symptoms and effects (acute and delayed)

- Symptoms/effects after skin contact : May cause an allergic skin reaction.

4.3. Immediate medical attention and special treatment, if necessary

Treat symptomatically.

SECTION 5: Fire-fighting measures

5.1. Suitable (and unsuitable) extinguishing media

- Suitable extinguishing media : Dry powder. Water spray. Foam.
- Unsuitable extinguishing media : Water.

5.2. Specific hazards arising from the chemical

- Reactivity : The product is non-reactive under normal conditions of use, storage and transport.

5.3. Special protective equipment and precautions for fire-fighters

- Protection during firefighting : Do not attempt to take action without suitable protective equipment. Self-contained breathing apparatus. Complete protective clothing.

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

6.1.1. For non-emergency personnel

- Emergency procedures : Only qualified personnel equipped with suitable protective equipment may intervene. Avoid breathing dust/fume/gas/mist/vapours/spray.

6.1.2. For emergency responders

- Protective equipment : Do not attempt to take action without suitable protective equipment. For further information refer to section 8: "Exposure controls/personal protection".

6.2. Environmental precautions

Avoid release to the environment. Notify authorities if product enters sewers or public waters.

6.3. Methods and material for containment and cleaning up

- For containment : Collect spillage.
- Methods for cleaning up : Mechanically recover the product. Notify authorities if product enters sewers or public waters.
- Other information : Dispose of materials or solid residues at an authorized site.

6.4. Reference to other sections

For further information refer to section 13.

BRAZE 711 VTG

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 7: Handling and storage

7.1. Precautions for safe handling

- Precautions for safe handling : Ensure good ventilation of the work station. Obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Avoid contact with skin and eyes. Wear personal protective equipment. Take all necessary technical measures to avoid or minimize the release of the product on the workplace. Limit quantities of product at the minimum necessary for handling and limit the number of exposed workers. Provide local exhaust or general room ventilation. Floors, walls and other surfaces in the hazard area must be cleaned regularly. Avoid breathing dust/fume/gas/mist/vapours/spray.
- Hygiene measures : Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reuse. Do not eat, drink or smoke when using this product. Always wash hands after handling the product. Separate working clothes from town clothes. Launder separately.

7.2. Conditions for safe storage, including any incompatibilities

- Storage conditions : Store locked up. Store in a well-ventilated place. Keep cool.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

Copper (7440-50-8)		
ACGIH	ACGIH TWA (mg/m ³)	0.2 mg/m ³ (fume)
OSHA	OSHA PEL (TWA) (mg/m ³)	0.1 mg/m ³ (fume) 1 mg/m ³ (dust and mist)
IDLH	US IDLH (mg/m ³)	100 mg/m ³ (dust, fume and mist)
NIOSH	NIOSH REL (TWA) (mg/m ³)	1 mg/m ³ (dust and mist) 0.1 mg/m ³ (fume)
Nickel (7440-02-0)		
ACGIH	ACGIH TWA (mg/m ³)	1.5 mg/m ³ (inhalable particulate matter)
OSHA	OSHA PEL (TWA) (mg/m ³)	1 mg/m ³
IDLH	US IDLH (mg/m ³)	10 mg/m ³
NIOSH	NIOSH REL (TWA) (mg/m ³)	0.015 mg/m ³
Silver (7440-22-4)		
ACGIH	ACGIH TWA (mg/m ³)	0.1 mg/m ³ (dust and fume)
OSHA	OSHA PEL (TWA) (mg/m ³)	0.01 mg/m ³
IDLH	US IDLH (mg/m ³)	10 mg/m ³ (dust)
NIOSH	NIOSH REL (TWA) (mg/m ³)	0.01 mg/m ³ (dust)

8.2. Appropriate engineering controls

- Appropriate engineering controls : Ensure good ventilation of the work station.
- Environmental exposure controls : Avoid release to the environment.

8.3. Individual protection measures/Personal protective equipment

Hand protection:

Protective gloves

Eye protection:

Safety glasses

Skin and body protection:

Wear suitable protective clothing

Respiratory protection:

[In case of inadequate ventilation] wear respiratory protection.

BRAZE 711 VTG

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state	: Solid
Colour	: No data available
Odour	: No data available
Odour threshold	: No data available
pH	: No data available
Melting point	: No data available
Freezing point	: Not applicable
Boiling point	: No data available
Flash point	: Not applicable
Relative evaporation rate (butylacetate=1)	: No data available
Flammability (solid, gas)	: Non flammable.
Vapour pressure	: No data available
Relative vapour density at 20 °C	: No data available
Relative density	: Not applicable
Solubility	: No data available
Log Pow	: No data available
Auto-ignition temperature	: Not applicable
Decomposition temperature	: No data available
Viscosity, kinematic	: No data available
Viscosity, dynamic	: No data available
Explosive limits	: Not applicable
Explosive properties	: No data available
Oxidising properties	: No data available

9.2. Other information

No additional information available

SECTION 10: Stability and reactivity

10.1. Reactivity

The product is non-reactive under normal conditions of use, storage and transport.

10.2. Chemical stability

Stable under normal conditions.

10.3. Possibility of hazardous reactions

No dangerous reactions known under normal conditions of use.

10.4. Conditions to avoid

None under recommended storage and handling conditions (see section 7).

10.5. Incompatible materials

No additional information available

10.6. Hazardous decomposition products

Under normal conditions of storage and use, hazardous decomposition products should not be produced.

SECTION 11: Toxicological information

11.1. Information on toxicological effects

Acute toxicity (oral)	: Not classified
Acute toxicity (dermal)	: Not classified
Acute toxicity (inhalation)	: Not classified

Nickel (7440-02-0)	
LD50 oral rat	> 9000 mg/kg
LC50 inhalation rat (mg/l)	> 10.2 mg/l (Exposure time: 1 h)

BRAZE 711 VTG

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Silver (7440-22-4)	
LD50 oral rat	> 5000 mg/kg
LD50 dermal rat	> 2000 mg/kg

Skin corrosion/irritation	: Not classified
Serious eye damage/irritation	: Not classified
Respiratory or skin sensitisation	: May cause an allergic skin reaction.
Germ cell mutagenicity	: Not classified
Carcinogenicity	: May cause cancer.

Nickel (7440-02-0)	
IARC group	2B - Possibly carcinogenic to humans
National Toxicity Program (NTP) Status	Reasonably anticipated to be Human Carcinogen
In OSHA Hazard Communication Carcinogen list	Yes

Reproductive toxicity	: Not classified
STOT-single exposure	: Not classified
STOT-repeated exposure	: Not classified

Nickel (7440-02-0)	
STOT-repeated exposure	Causes damage to organs through prolonged or repeated exposure.

Aspiration hazard	: Not classified
Viscosity, kinematic	: No data available
Symptoms/effects after skin contact	: May cause an allergic skin reaction.

SECTION 12: Ecological information

12.1. Toxicity

Ecology - general	: The product is not considered harmful to aquatic organisms nor to cause long-term adverse effects in the environment. Very toxic to aquatic life.
-------------------	---

Copper (7440-50-8)	
LC50 fish 1	0.0068 - 0.0156 mg/l (Exposure time: 96 h - Species: Pimephales promelas)
EC50 Daphnia 1	0.03 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])
LC50 fish 2	< 0.3 mg/l (Exposure time: 96 h - Species: Pimephales promelas [static])

Nickel (7440-02-0)	
LC50 fish 1	> 100 mg/l (Exposure time: 96 h - Species: Brachydanio rerio)
EC50 Daphnia 1	> 100 mg/l (Exposure time: 48 h - Species: Daphnia magna)
LC50 fish 2	1.3 mg/l (Exposure time: 96 h - Species: Cyprinus carpio [semi-static])
EC50 Daphnia 2	1 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])

Silver (7440-22-4)	
LC50 fish 1	0.00155 - 0.00293 mg/l (Exposure time: 96 h - Species: Pimephales promelas [static])
EC50 Daphnia 1	0.00024 mg/l (Exposure time: 48 h - Species: Daphnia magna [Static])
LC50 fish 2	0.0062 mg/l (Exposure time: 96 h - Species: Oncorhynchus mykiss [flow-through])

12.2. Persistence and degradability

No additional information available

12.3. Bioaccumulative potential

No additional information available

12.4. Mobility in soil

No additional information available

12.5. Other adverse effects

No additional information available

BRAZE 711 VTG

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

SECTION 13: Disposal considerations

13.1. Disposal methods

Waste treatment methods : Dispose of contents/container in accordance with licensed collector's sorting instructions.

SECTION 14: Transport information

Department of Transportation (DOT)

In accordance with DOT

Not applicable

Transportation of Dangerous Goods

Not applicable

Transport by sea

Not applicable

Air transport

Not applicable

SECTION 15: Regulatory information

15.1. US Federal regulations

Copper (7440-50-8)

Listed on the United States TSCA (Toxic Substances Control Act) inventory
Subject to reporting requirements of United States SARA Section 313

CERCLA RQ	5000 lb no reporting of releases of this hazardous substance is required if the diameter of the pieces of the solid metal released is >100 µm
-----------	---

Nickel (7440-02-0)

Listed on the United States TSCA (Toxic Substances Control Act) inventory
Subject to reporting requirements of United States SARA Section 313

CERCLA RQ	100 lb no reporting of releases of this hazardous substance is required if the diameter of the pieces of the solid metal released is >100 µm
-----------	--

Silver (7440-22-4)

Listed on the United States TSCA (Toxic Substances Control Act) inventory
Subject to reporting requirements of United States SARA Section 313

CERCLA RQ	1000 lb no reporting of releases of this hazardous substance is required if the diameter of the pieces of the solid metal released is >100 µm
-----------	---

15.2. International regulations

Copper (7440-50-8)

Listed on the TCSI (Taiwan Chemical Substance Inventory)


Nickel (7440-02-0)

Listed on the TCSI (Taiwan Chemical Substance Inventory)

Silver (7440-22-4)

Listed on the TCSI (Taiwan Chemical Substance Inventory)

15.3. US State regulations

 **WARNING:** This product can expose you to Nickel, which is known to the State of California to cause cancer. For more information go to www.P65Warnings.ca.gov.

BRAZE 711 VTG

Safety Data Sheet

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations

Component	Carcinogenicity	Developmental toxicity	Reproductive toxicity male	Reproductive toxicity female	No significant risk level (NSRL)	Maximum allowable dose level (MADL)
Nickel(7440-02-0)	X					

Component	State or local regulations
Copper(7440-50-8)	U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) List
Nickel(7440-02-0)	U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) - Special Hazardous Substances U.S. - Pennsylvania - RTK (Right to Know) List
Silver(7440-22-4)	U.S. - Massachusetts - Right To Know List U.S. - New Jersey - Right to Know Hazardous Substance List U.S. - Pennsylvania - RTK (Right to Know) - Environmental Hazard List U.S. - Pennsylvania - RTK (Right to Know) List

SECTION 16: Other information

according to Federal Register / Vol. 77, No. 58 / Monday, March 26, 2012 / Rules and Regulations


Full text of H-statements:

H317	May cause an allergic skin reaction.
H350	May cause cancer.

NFPA health hazard : 2 - Materials that, under emergency conditions, can cause temporary incapacitation or residual injury.

NFPA fire hazard : 1 - Materials that must be preheated before ignition can occur.

NFPA reactivity : 0 - Material that in themselves are normally stable, even under fire conditions.

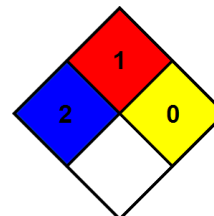

Hazard Rating

Health : 2 Moderate Hazard - Temporary or minor injury may occur
* - Chronic (long-term) health effects may result from repeated overexposure

Flammability : 1 Slight Hazard - Materials that must be preheated before ignition will occur. Includes liquids, solids and semi solids having a flash point above 200 F. (Class IIIB)

Physical : 0 Minimal Hazard - Materials that are normally stable, even under fire conditions, and will NOT react with water, polymerize, decompose, condense, or self-react. Non-Explosives.

Personal protection : B
B - Safety glasses, Gloves

SDS US (GHS HazCom 2012)

Although reasonable care has been taken in the preparation of this document, we extend no warranties and make no representations as to the accuracy or completeness of the information contained therein, and assume no responsibility regarding the suitability of this information for the user's intended purposes or for the consequences of its use. Each individual should make a determination as to the suitability of the information for their particular purpose(s).
Lucas-Milhaupt, Inc.